Assembly & Installation Instructions



136340 Henry Pendant; Large

Page 1 of 2

CAUTION: FAILURE TO INSTALL THIS FIXTURE PROPERLY MAY RESULT IN SERIOUS PERSONAL INJURY OR DEATH AND PROPERTY DAMAGE. We recommend installation by a licensed electrician.

This product must be installed in accordance with applicable installation code(s), by a person familiar with the construction and operation of the product and the hazards involved.*

Caution: Do not exceed maximum wattage noted on fixture. Use only recommended bulbs with fixture.

Please Note: After installation extra hardware and accessories are possible due to our kits are used on multiple products and options.

Stem Assembly (Figure 1)


Component Parts

- A Fixture Pipe
- **B** Fixture Coupling
- 1. Carefully unpack the fixture from the carton.
- 2. Carefully slip fixture pipe (A), threaded end first, over fixture wires.

Note: If both ends are threaded either end can go on first

3. Apply a drop of the supplied thread locking compound to the threads of fixture pipe (A) and screw pipe into fixture coupling (B), being careful not to twist or pinch the wires.

Note: Application of the thread locking compound is necessary to prevent the stem from loosening during regular maintenance and cleaning of the fixture. Be certain to apply the compound.







Component Parts

- C Crossbar
- D Jam Nut
- E Threaded Nipple
- F Canopy
- G Canopy Ring

Caution: Be sure power is off at the main breaker box prior to installation.

- 1. Thread the jam nut (D) and crossbar (C) onto threaded nipple (E); leave both parts loose.
- 2. Using two machine screws (not provided), temporarily fasten the crossbar (C) to the electric box. *Note:* A new electric box comes with screws. When replacing a fixture, retain the existing screws for use with the new fixture.
- 3. Adjust the length of threaded nipple (E) in crossbar (C) so that canopy ring (G) will hold canopy (F) against the ceiling with no threads showing for best appearance. When the correct adjustment is established, tighten jam nut (D) against crossbar (C) to hold the adjustment.
- 4. Remove the crossbar (C) with stem from the electrical box and proceed with the assembly instructions.

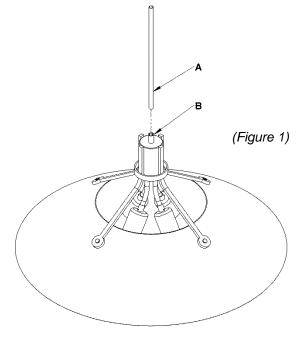



(continued)



Assembly & Installation Instructions




136340 Henry Pendant; Large

Complete Assembly and Install Fixture (Figure 3 & 4)

Component Parts


- Fixture Pipe Α
- С Crossbar
- F Canopy
- G Canopy Ring
- Canopy Pipe
- Plastic Sleeve I
- J Clutch
- K Set Screw
- **Ground Screw**
- Fixture M

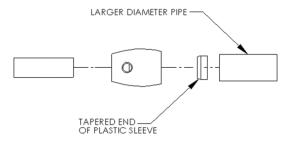

(Figure 3)

Caution: Be sure power is off at the main breaker box prior to installation.

- Slide canopy ring (G) first then canopy (F) over fixture pipe (A) until both parts rest on fixture (M). Make sure smaller diameter side of canopy ring (G) is oriented up toward the canopy (F).
- Slip wires from the fixture pipe (A) through the canopy pipe (H).
- 3. Unscrew the clutch (J) from the canopy pipe (H); slide it across the wires and onto the fixture pipe (A). Follow this with the plastic sleeve (I), oriented so the tapered end nests in the clutch (J) (Figure 3).
- Slide the canopy pipe (H) as far as necessary to set desired fixture length. Be careful not to scratch the pipe surface and to pull excess wire up through the canopy pipe (H). There must be a minimum 1-1/2" of inner pipe inside the outer pipe. Hand-tighten the clutch to the canopy pipe (H) to temporarily hold this adjustment. The clutch is not securely fastened at this point; do not depend on it to hold the fixture.
 - Important: To ensure full connection strength, be sure the tapered end of the plastic clutch sleeve is oriented toward the clutch when assembled and securely tighten set screw (Figure 3).
- Using two machine screws (not provided), fasten the crossbar (C) to the electric box.
 - **Note:** A new electric box comes with screws. When replacing a fixture, retain the existing screws for use with the new fixture.
- Using suitable wire connectors (not provided), connect fixture wires to supply wires (white to white supply, black to black supply). Attach a pigtail lead to crossbar ground screw (L) and connect all ground wires (bare copper or green to bare copper or green). Push wires back into outlet box. Caution: Make sure wire connectors are twisted on securely, and no bare wire is exposed.

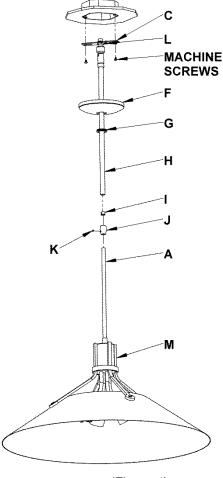

(Figure 4)

- 7. Slide canopy (F) against ceiling, and secure with canopy ring (G).
- Once the fixture is fastened to the ceiling, tighten the set screw (K) firmly with hex wrench provided.
- Install bulbs (not included).
- 10. Restore electricity at main breaker.

If you need further assistance, or find that you are missing any parts, please contact the dealer from which you purchased this product. We hope you enjoy your fixture

Hubbardton Forge will not be liable for injury or damage caused by improper installation, lamping or use of this fixture.

